


CREALITY

3D Printer User Manual

3D打印机使用说明书

LD-006

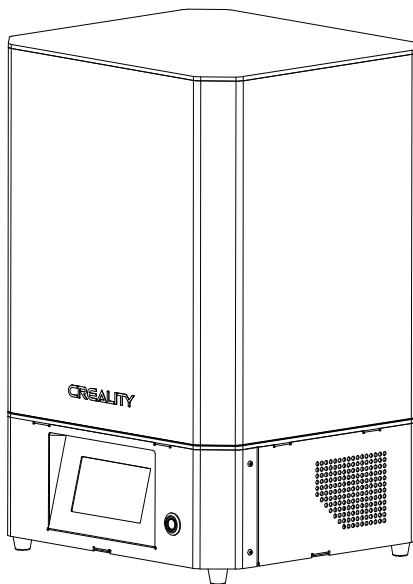

V1.0

Content 目录

Dear Consumers,

Thank you for choosing our products. For the best experience, please read the instructions before operating the Printer. Our teams will always be ready to render you the best services. Please contact us via the phone number or e-mail address provided at the end when you encounter any problem with the Printer.

For a better experience in using our product, you can also learn how to use the Printer in the following ways:

View the accompanied instructions and videos in the U disk.

Visit our official website www.creality.com to find relevant software/hardware information, contact details and operation and maintenance instructions.

尊敬的创想三维用户：

感谢您选择、使用创想三维的产品。为了您使用方便，请您在使用之前仔细阅读该说明书，并严格按照说明书的指示进行操作。

创想三维团队时刻准备为您提供优质的服务。在使用过程中无论遇到什么问题，请按照说明书结尾所提供的电话、邮箱与我们联系。

为了您能够更好地体验我们的产品，您还可以从以下方式获取设备操作知识：

随机使用说明：你可以在U盘内找到相关使用说明及视频。

创想三维官网：www.cxsw3d.com 您可以登陆创想三维官网寻找相关软硬件、联系方式、设备操作、设备保养等信息。

A

Notes

使用须知

B

Assemble the 3D Printer

组装 3D 打印机

C

Use the 3D Printer

使用 3D 打印机

Level the Platform

调平

Load Resin

装料

Release Film Instructions

离型膜包装说明

Start Printing

首次打印

Clean the Resin Vat

料盘清理


NOTES 使用须知

1. Do not use the printer any way other than described herein in order to avoid personal injury or property damage.
2. Do not place the printer near any heat source or flammable or explosive objects. We suggest placing it in a well-ventilated, low-dust environment.
3. Do not expose the printer to violent vibration or any unstable environment, as this may cause poor print quality.
4. Please use recommended resin to in case damage of machine.
5. Do not use any other power cable except the one supplied. Always use a grounded three-prong power outlet.
6. Please do not open the plastic cover during usage, otherwise the printing will be interrupted.
7. Do not wear cotton gloves when operating the printer. Such cloths may become tangled in the printers moving parts leading to burns, possible bodily injury, or printer damage.
8. Please wait a moment after the print is finished. And please wear gloves to take out the model by tools.
9. Clean the printer frequently. Always turn the power off when cleaning, and wipe with a dry cloth to remove dust, adhered printing plastics or any other material off the frame, guide rails, or wheels. Use glass cleaner or isopropyl alcohol to clean the print surface.
10. Children under 10 years should not use the printer without supervision.
11. Tips: Do not plug or unplug the power cord when power on.
12. Users should comply with the laws and regulations of the corresponding countries and regions where the equipment is located (used), abide by professional ethics, pay attention to safety obligations, and strictly prohibit the use of our products or equipment for any illegal purposes. Creality will not be responsible for any violators' legal liability under any circumstance.

- 1、请勿尝试任何使用说明中没有描述的方法来使用本机，避免造成的意外人身伤害和财产损失；
- 2、请勿将本机放置在易燃易爆物品或高热源附近，请将本机放置在通风、阴凉、少尘的环境内；
- 3、请勿将打印机放置在振动较大或者其他不稳定的环境内，机器晃动会影响打印机打印质量；
- 4、建议使用厂家推荐耗材，以免造成机器损坏；
- 5、请勿在安装过程中使用其他产品电源线代替，请使用本机附带的电源线，电源插头需插在带有地线的三孔插座；
- 6、请勿在打印机工作时打开打印机面盖，以免影响打印；
- 7、请勿在操作打印机时戴棉手套，以防可动部件对人身部位造成卷入挤压和切割伤害；
- 8、在打印完毕后稍等片刻，带上手套后再取下打印平台，借助工具将平台上的模型取下，清理时请勿直接用手触摸；
- 9、常做产品维护，定期在断电的情况下，用干布对打印机做机身清洁，拭去灰尘和粘结的打印材料、导轨上的异物；
- 10、年龄在10岁以下的儿童，请勿在没有人员监督的情况下使用本机，以免造成人身伤害；
- 11、温馨提示：请勿带电插拔电线；
- 12、使用者应遵守设备所在地（使用地）相应国家、地区法律法规，恪守职业道德，注意安全义务，严禁将我司的产品或设备使用在任何非法用途上。
如有违反者所应承担的相关法律责任我司概不负责。

Equipment Introduction

设备简介

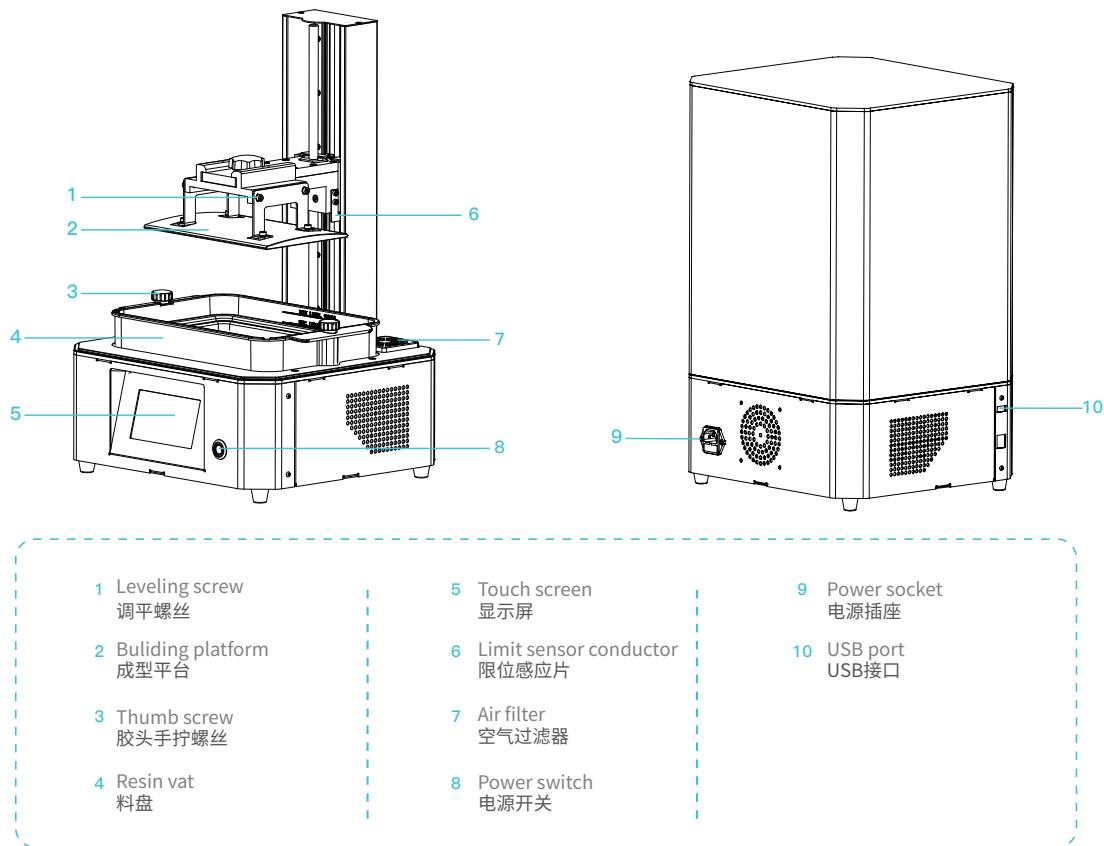

Equipment Parameters

设备参数

Basic Parameters 基本参数	
Model 型号	LD-006
Software language 中英切换	English 中文
Print method 打印方式	U disk U盘
X/Y-axis resolution X、Y分辨率	3840*2400 50μm
Z-axis precision Z轴精度	0.01mm-0.1mm(layer thickness 即层厚)
Print speed 打印速度	1-4S/ layer 即每层打印时间
Special filaments 专用耗材	Common rigid photosensitive resin, Standard resin, High elasticity, High hardness, High toughness, Dental model resin. 普通刚性光敏树脂、标准树脂、弹性树脂、高硬度、高韧性树脂、牙模树脂
Light source configuration 光源配置	UV integrated lamp bead (wavelength 405nm) 紫外线集成灯珠 (波长405nm)
Operation system 操作系统	Windows XP and above systems Windows XP 以上系统
Nominal power 额定功率	250W
Print size 成型尺寸	192*120*250mm (length*width * height) 192*120*250mm (长*宽*高)
Machine size 设备尺寸	325*290*500mm
Package size 包装尺寸	430*400*600mm
Machine weight 机器重量	13.5KG
Gross weight 机器毛重	17.5KG
Display screen 显示屏幕	4.3inch 4.3英寸

Package Content

零部件清单

Tool list 工具包清单



- ① U disk x 1
U盘



- ② Screwdrivers x 1set
螺丝刀工具包



- ③ Brush x 1
油漆刷



- ④ Plastic blade x 1
塑胶铲刀



- ⑤ Resin filter x 4
纸漏斗



- ⑥ Release film x 1
离型膜



- ⑦ Metal blade x 1
金属铲刀



- ⑧ Power cord x 1
电源线



- ⑨ Vat cover x 1
料槽防尘盖




- ⑩ Calibration card x 1
校准卡片

Tips: the above accessories are for reference only, in kind prevail! 注意:以上配件仅供参考,请以实物为准!


1

Assemble the 3D Printer


组装3D打印机

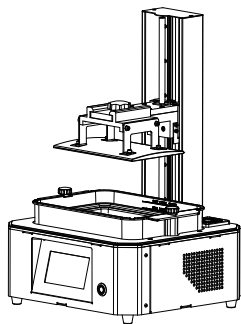

① Machine body | 主机 x 1

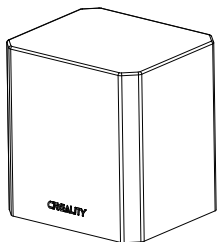

② Plastic cover | 上盖 x 1

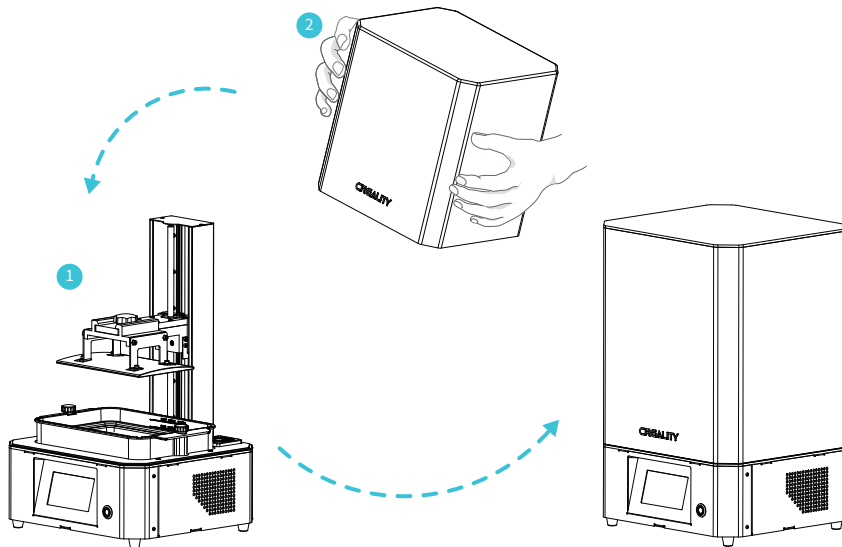

Note: Put the plastic cover on the machine body and the installation is completed.


注意：上盖嵌入主机即安装完成。

2


Interface Information

界面信息

Tools

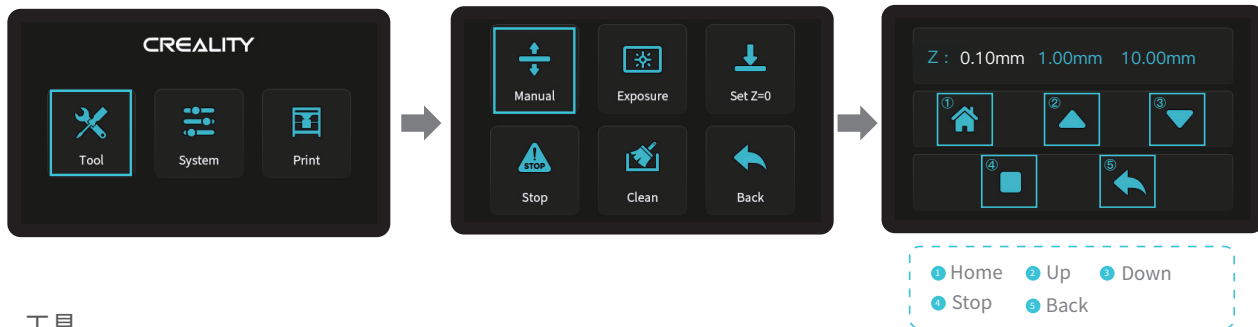


工具

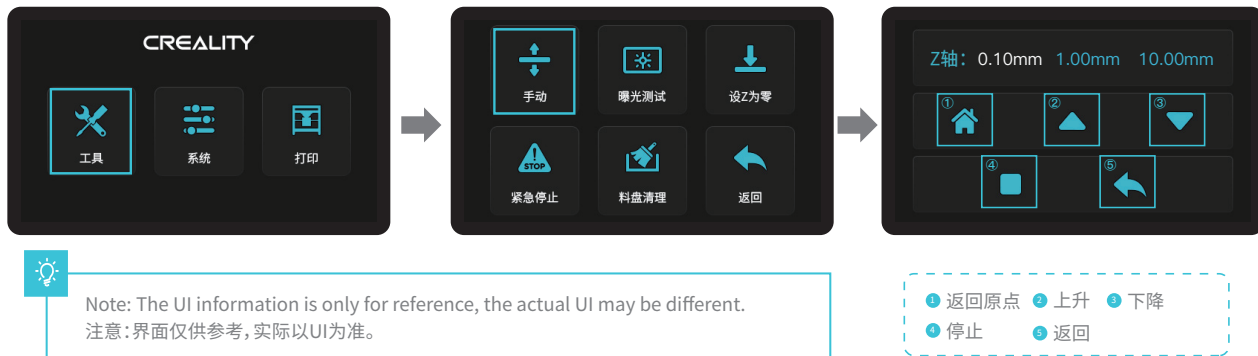

Interface Information

界面信息

System

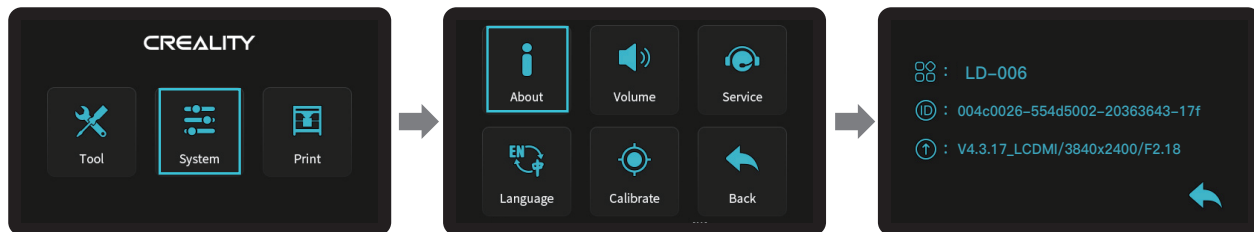

系统




Note: The UI information is only for reference, the actual UI may be different.
注意：界面仅供参考，实际以UI为准。


Interface Information

界面信息

Print

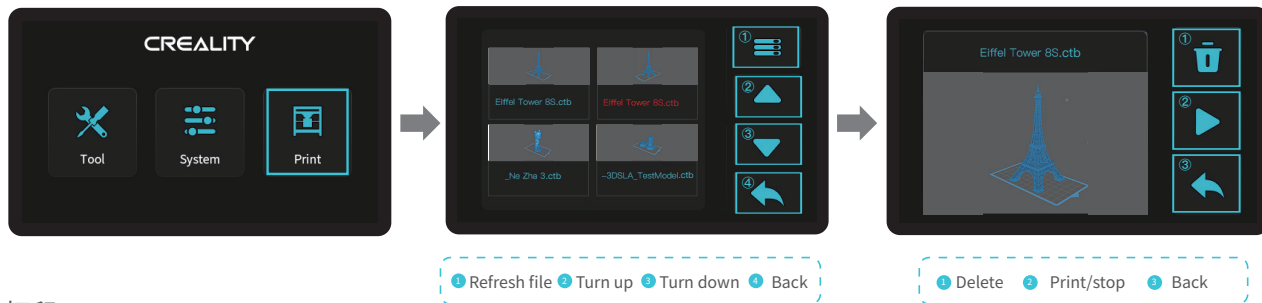

打印

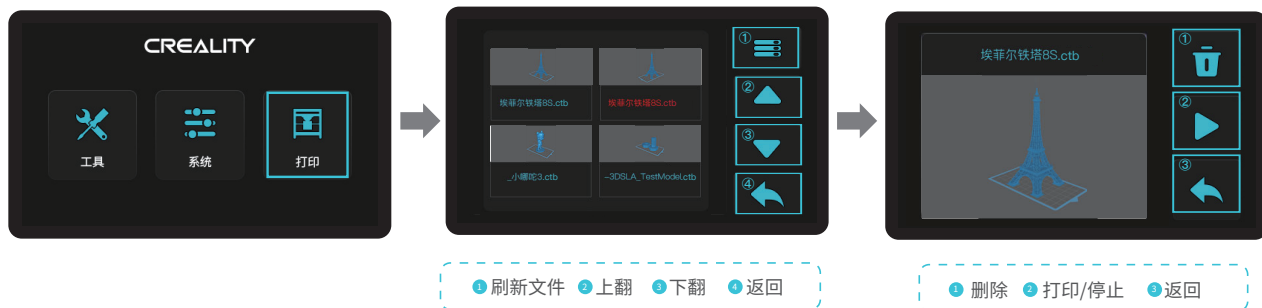




Note: The UI information is only for reference, the actual UI may be different.

注意: 界面仅供参考, 实际以UI为准。

3

Level Platform 1

调平平台 1

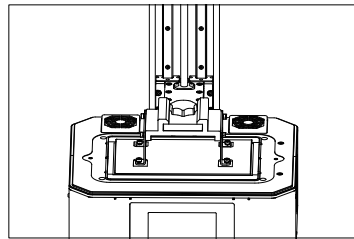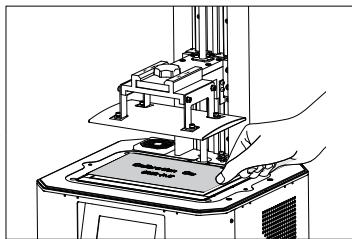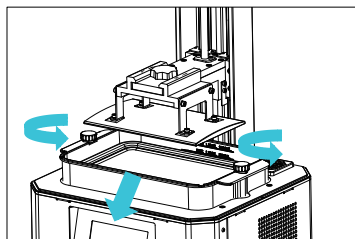

1. First raise the platform, then loosen rubber screws on the left and right sides of the resin vat, and take out the resin vat.
进行打印平台的校准，首先上升平台，拧松料槽左右两侧胶头手拧螺丝，将料槽取出。

2. Place the calibration card on the printing screen, go "Tools → Manual → Home" with the touch screen, and check whether the platform sticks into the calibration card evenly.

将校准卡片贴合打印屏，按工具→手动→回原点，检查平台是否与校准卡片均匀贴合。




Note: The printing platform has been leveled at the factory. If it needs leveling due to transportation or other reasons, please follow the steps below to adjust the printing platform.

注意：打印平台出厂时已调平，若因运输或其他原因需要调平，可以进行以上步骤进行打印平台调平。



4

Level Platform 2 调平平台 2




If the platform does not stick to the print screen, do as the following:
如果没有贴紧打印屏, 请进行如下操作:

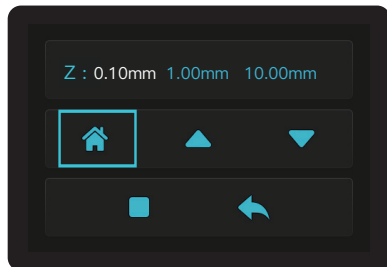

1. After unscrewing the leveling screws, press "Home" to keep the platform and the print screen parallel.

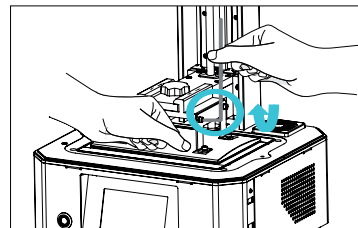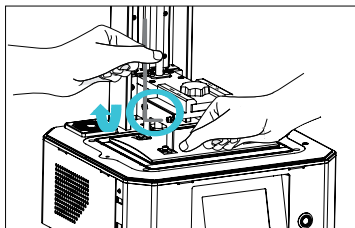

2. Gently press the platform and tighten 4 screws clockwise, and the platform can be leveled successfully.

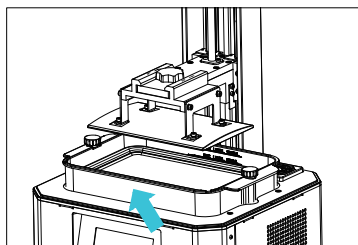
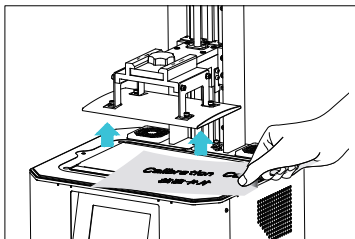
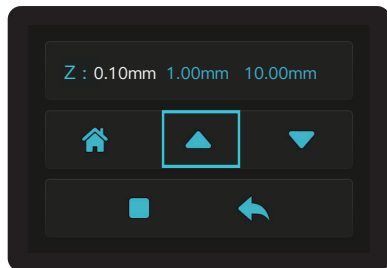


3. Move up the z-axis to a proper position, remove the calibration card and install the resin vat back, and then tighten the fixing screws at both ends of the resin vat.

Level Platform 2 调平平台 2




If the platform does not stick to the print screen, do as the following:

如果没有贴紧打印屏, 请进行如下操作:

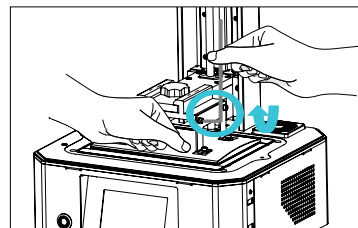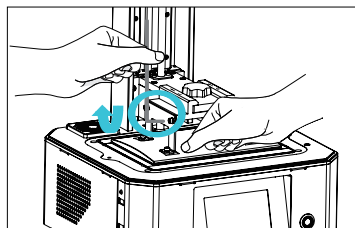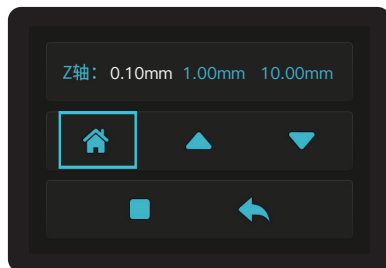

1. 拧松调平螺丝后, 按触摸屏“原点”, 保持平台与底板部分平衡。

2. 轻轻压平台两端, 顺时针拧紧4个平台螺丝, 即平台调平成功。

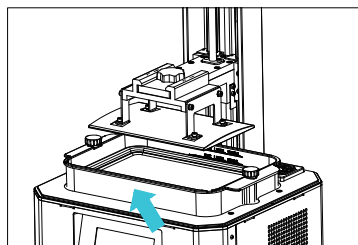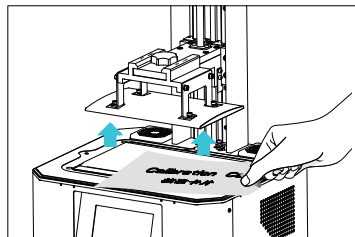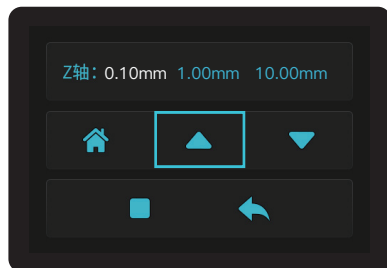


3. 控制Z轴上移, 至合适位置, 将校准卡纸取出, 放入料盘, 对准料盘两端螺孔后, 旋紧两端的料盘固定螺丝。

5

Load Resin 装料

Pour the UV photosensitive resin into the resin vat. The slot capacity is 500ml/1000ml.
将3D打印机 UV 光敏树脂倒入料盘,槽位容量分别:500ml/1000ml。

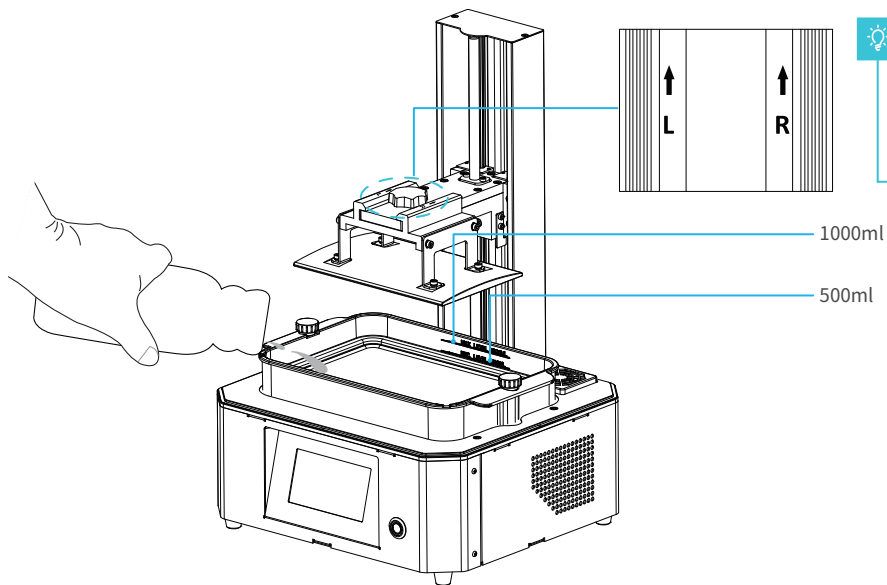

Please pay attention to the orientation marks and keep the printing platform assembled in the right direction. Otherwise it may lead to leveling failure!
请按照标识正确安装固定成型平台,装反会影响调平效果!



Tips: How to change resin:

Take out the resin vat slowly, pour out the remaining resin into the container, clean the resin vat, pour in new resin, and then install the resin vat to the machine.

提示: 如何更换耗材?

将料盘缓缓取出,把剩余树脂倒入容器,清洗干净料盘,重新倒入新树脂,再把料盘安装到机器即可。



Caution : Resin may cause skin irritation or an allergic skin reaction. Please wear gloves before use to avoid direct contact with the skin.

警示: 请戴上手套方可进行装料,光敏树脂为刺激性材料,避免接触到皮肤。


6

Release Film Instructions


离型膜安装说明

Installation steps

安装步骤

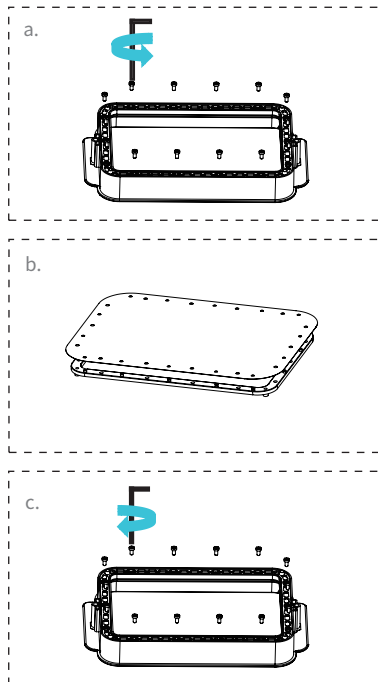

- First, remove the 14 screws at the bottom of the vat and take down the old release film.
首先拆卸料槽底部的14颗螺丝,取出坏的离型膜。
- Prepare the new release film, peel off the the protective films on both sides of the release film. Align the holes and fit the release film on the clamping ring.
撕掉新的离型膜两个面上的保护膜,对好孔然后将离型膜套在压圈上的柱子上。
- Finally, place the film-ring assembly back into the vat frame gently, then intall and tighten the fixing screws diagonally.
最后将套好离型膜的压圈放回料槽,安装14颗螺丝并采用对角方式锁紧。
- The installed release film is as shown.
安装好的离型膜如下图。

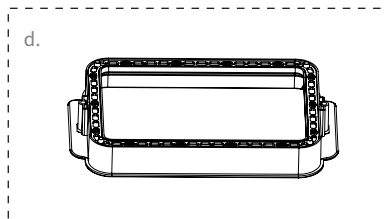
Parameters
规格参数尺寸:190mm*266mm
(Size)厚度:0.15-0.2mm
(Thickness)透光率:95%
(Light Transmittance)

7


Start Printing

首次打印


1. Slice

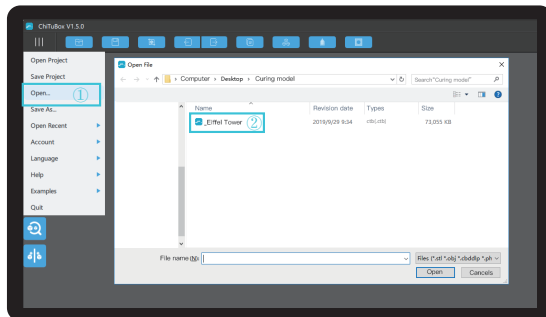


1. Open the slice software of LCD 3D printer, click “open” on the left of the screen and add model file.

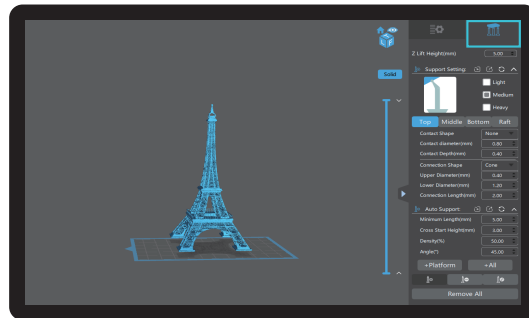

2. If the model needs to add support, click the upper right icon to set corresponding parameters.

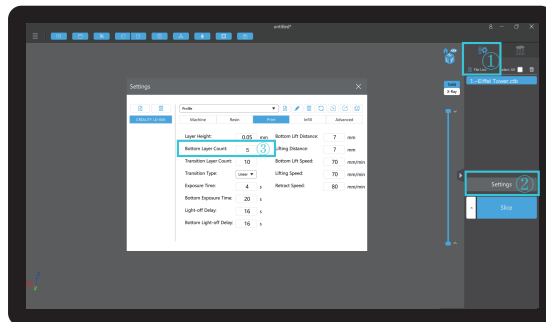

3. Click icon ①→click ② “Setting”→setting slice parameters (recommend to set parameters of bottom layer as 5-20).

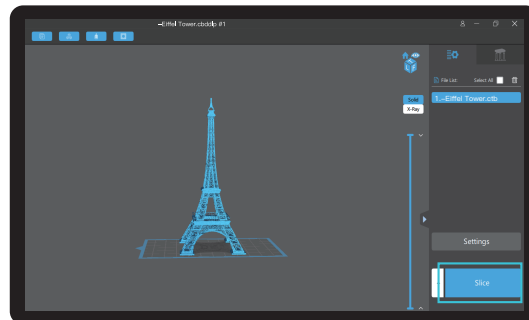


4. Click “Slice”→waiting for slice to be finished→save the sliced file(You are welcome to find more details of slicing tutorial on the official website www.creality.com).


Start Printing

首次打印


1. 切片

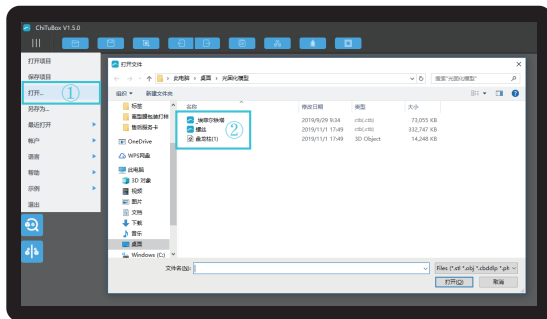


1. 打开LCD光固化3d打印切片软件, 界面左方点击“打开”添加模型文件;

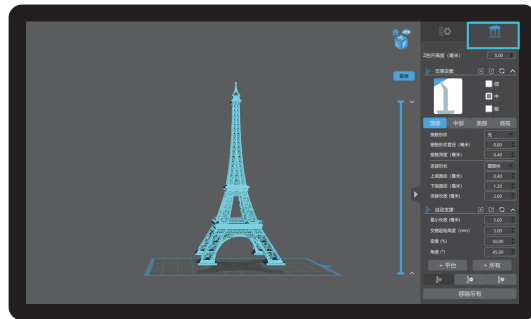

2. 根据模型如需添加支架, 点击右上方图标, 设置相应参数;

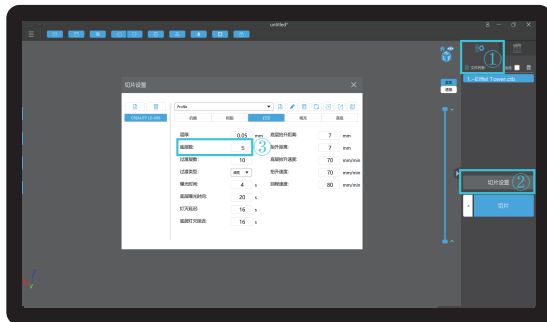

3. 点击图标①→点开切片设置②→设置切片参数(底层数量建议设置5-20);

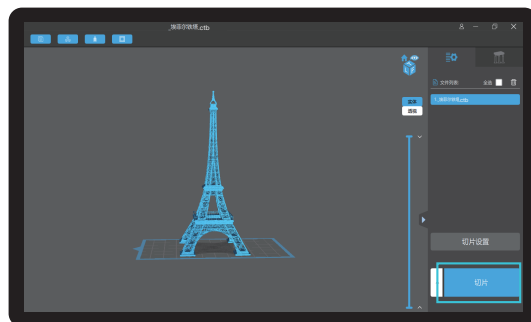


4. 点击切片→等待完成切片后→另存切片好的文件。
(*切片教程详见官网切片视频www.cxsw3d.com)


Start Printing

首次打印


2. Print

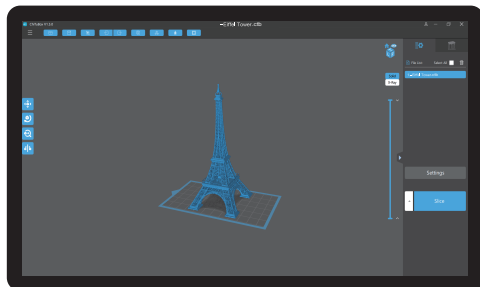


1. Generate CTB file, and save the file to U disk.

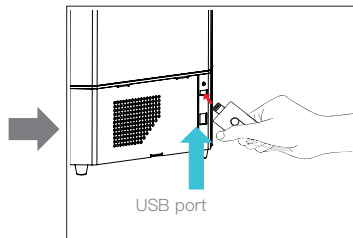


2. Insert the U disk → press the print button.

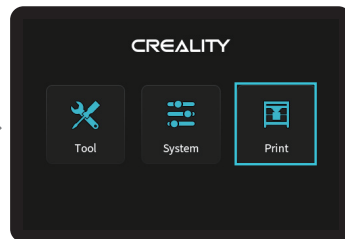

2. 打印

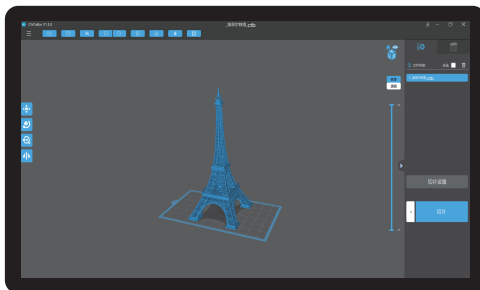

1. 生成 CTB 文件→保存文件到U盘

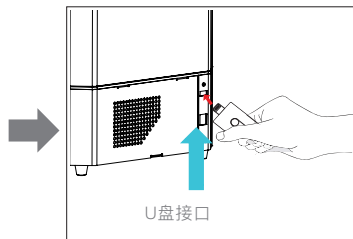


2. 插入U盘→按下打印按键




Start Printing


首次打印

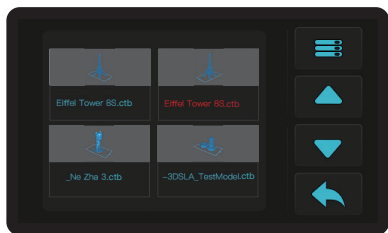

3. Press “up” or “down” to select files.

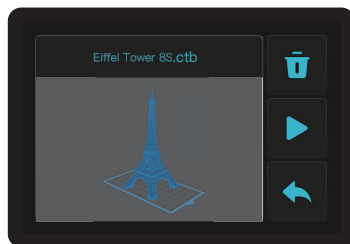

4. Select the file to be printed and press “print”.

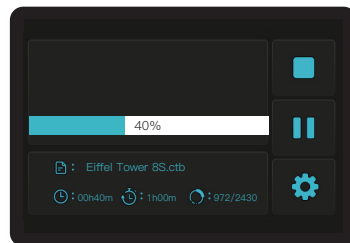


5. Printing.



3. 上下翻可选择文件



4. 选中需要打印的文件, 按下打印键

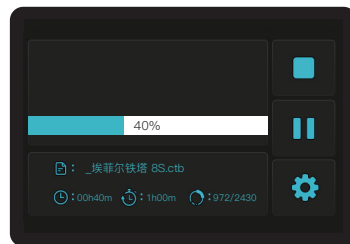


5. 正在打印中

8

Clean the Resin Vat

料盘清理

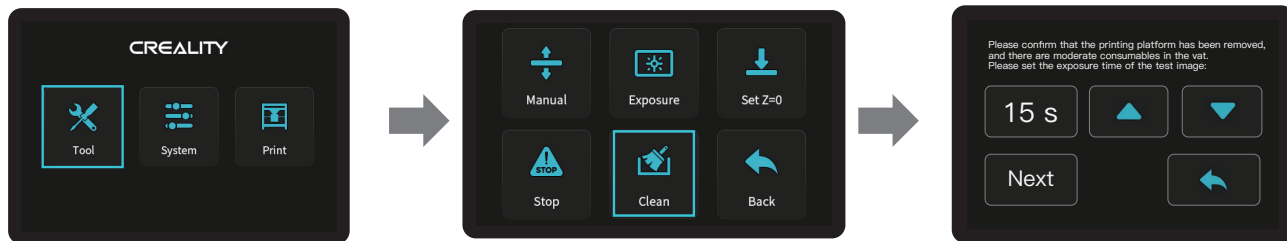


*If there is residue in resin vat before printing, please clean resin vat first. The cleaning time is generally set to 15 seconds and then shovel it off with a plastic blade.




*如打印前料盘有残渣，请先清理料盘，一般设置清理时间为15s,再用塑胶铲刀铲掉。

Wiring Connection


电路接线

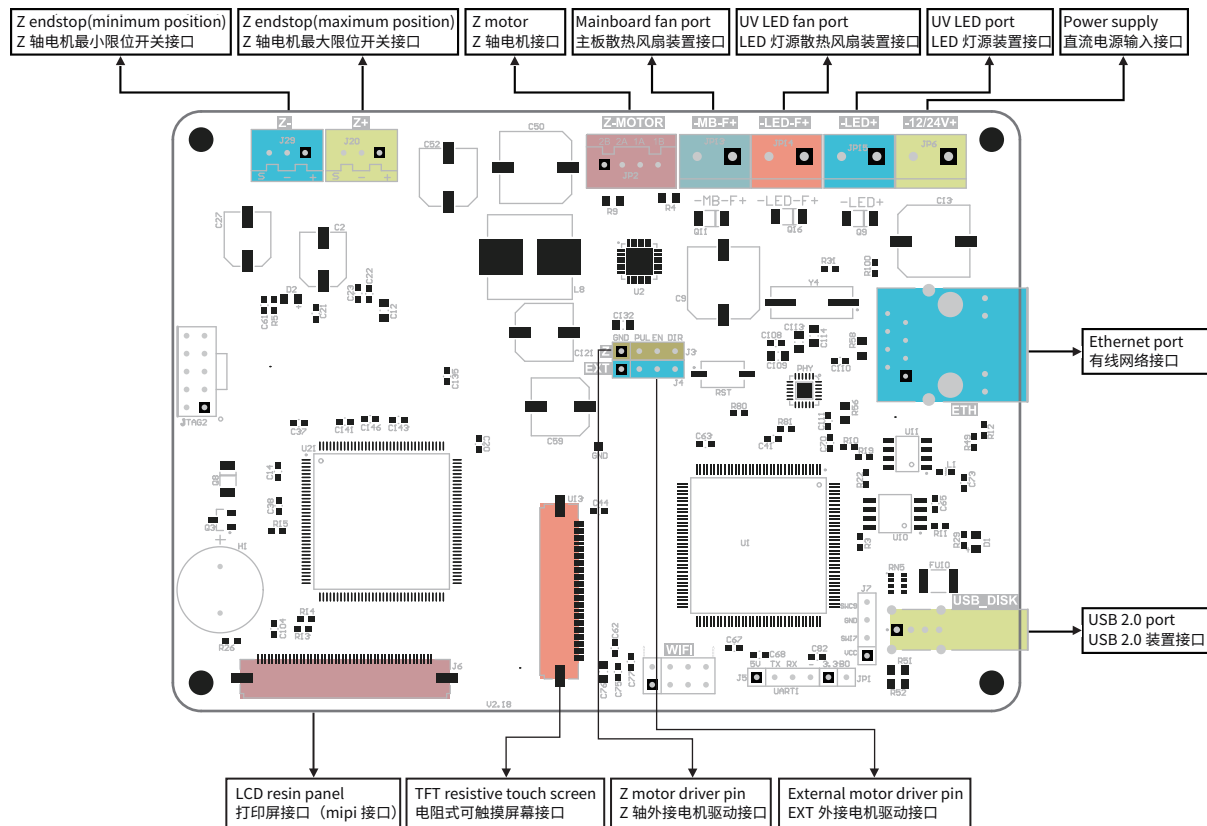

Troubleshooting

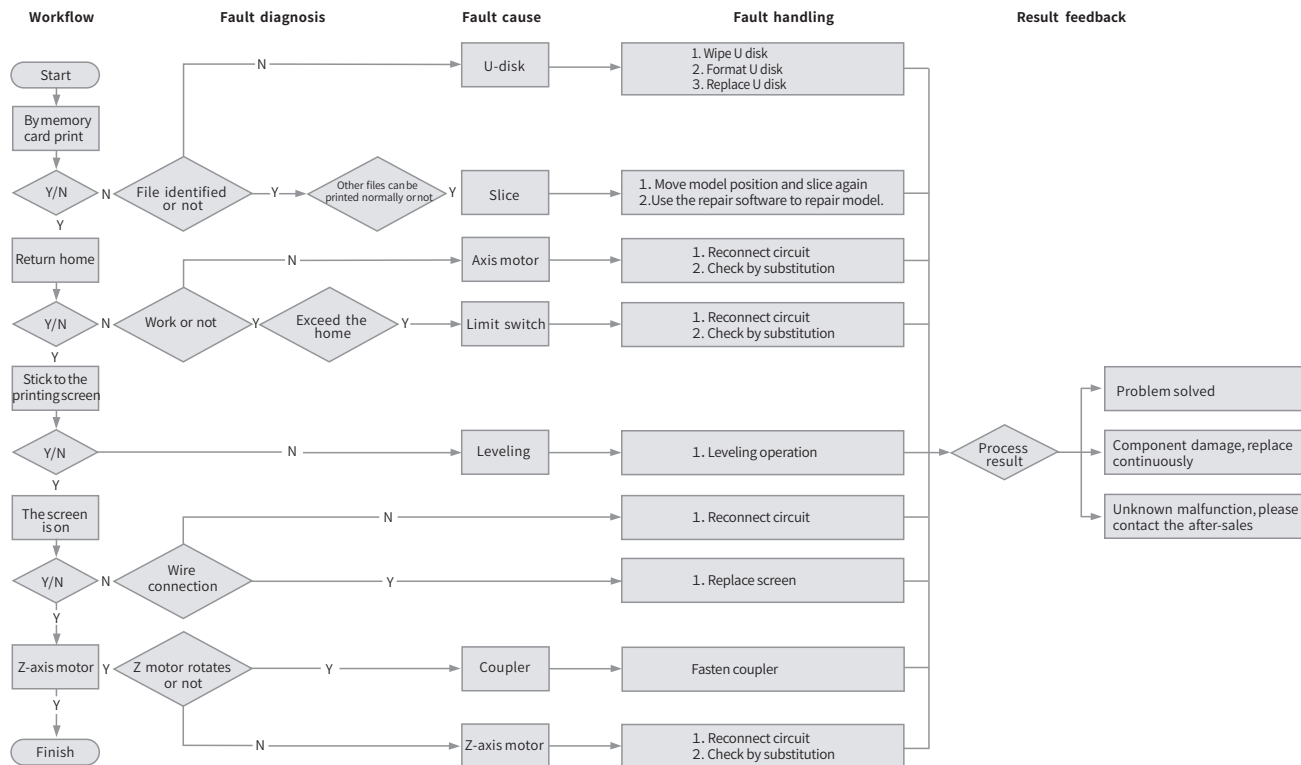

故障检修

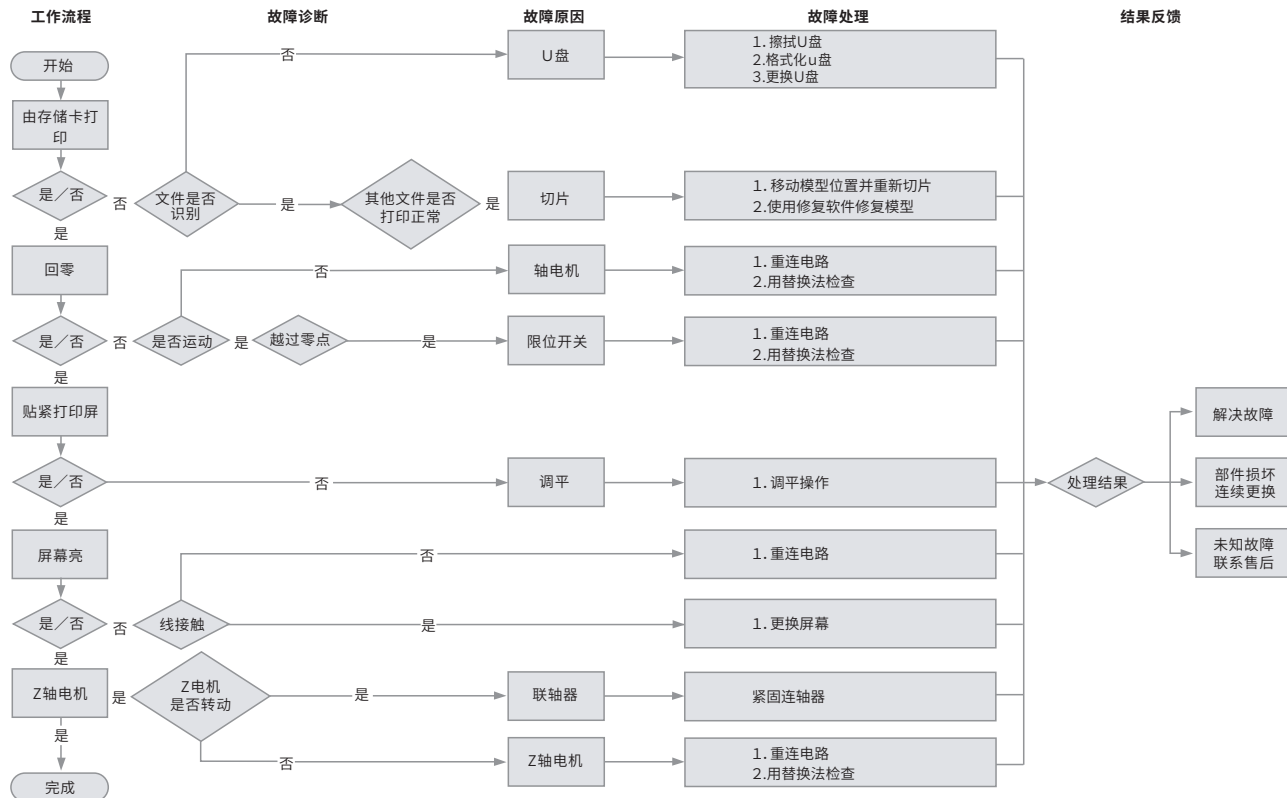

Due to the differences between different machine models, the physical objects and the final images can differ. The final explanation rights shall be reserved by Shenzhen Crealty 3D Technology Co., Ltd.

因每款机型不同，实物与图可能有所差异，请以实物为准，最终解释权归深圳市创想三维科技股份有限公司所有。



Scan To Learn More
扫码了解更多

SHENZHEN CREALITY 3D TECHNOLOGY CO., LTD.

Add: 18F, JinXiuHongDu Building, Meilong Blvd., Longhua Dist.,
Shenzhen, China 518131

Official Website: www.crealty.com

Tel: +86 755-8523 4565

E-mail: info@creality.com cs@creality.com

深圳市创想三维科技股份有限公司

深圳市龙华区民治街道新牛社区梅龙大道锦绣鸿都大厦18F

公司网站: www.cxsw3d.com

服务热线: 400 6133 882 0755-8523 4565

